

6. PROBLEM SOLVING


▲ DANGER! If, at any time, the face plate in the cartridge **FAILS** to darken when exposed to a welding spark, **DO NOT USE**. Remove cartridge and return to your dealer for checking. Continued use of the product with auto darkening feature **NOT FUNCTIONING** may **DAMAGE YOUR EYES** and **CAUSE BLINDNESS**. Use of malfunctioning product will invalidate the warranty, and any right of claim on any insurance policy.

IRREGULAR DARKENING OR DIMMING.	The headband may have been unevenly set on the two sides of the helmet (unequal distances from the eyes to the shade cartridge).	Readjust the distance of the shade cartridge.
SHADE CARTRIDGE DOES NOT DARKEN OR FLICKERS.	The sensors are soiled or obstructed. Front cover lens oiled or damaged. Welding current too low.	Clean Clean or replace Adjust weld amps
POOR VISION	Operative lenses and/or shade cartridge soiled. Insufficient ambient light. Shade level incorrectly set.	Check, clean or replace Adjust light Refer to Shade Guide for setting
SLOW RESPONSE	Operating temperature too low	Do not use at temperatures below -5°C (23°F) .
WELDING HELMET SLIPS	Headband adjustments incorrect.	Refer to section 4.

7. SPARE PARTS

REF.	PART NO.	DESCRIPTION
(fig.4)	168/445505	Front cover lens 112x93mm
(fig.5a)	168/445510	Shade cartridge
	168/445525	Shade knob
	168/445530	Inside cover lens
	168/445535	Helmet shell
(fig.6-X)	168/445540	Sweat band
(fig.6)	168/445545	Adjustable Head band
(fig.6-6)	168/445550	Block nut
(fig.6-2)	168/445555	Washer x 4
(fig.6-4)	168/445560	Limitation washer (adjustable)
(fig.6-3)	168/445565	Limitation washer LEFT
(fig.2)	168/445570	Screw
(fig.6-3)	168/445575	Limitation washer RIGHT

Issue date 14/10/03
Issue No, 3

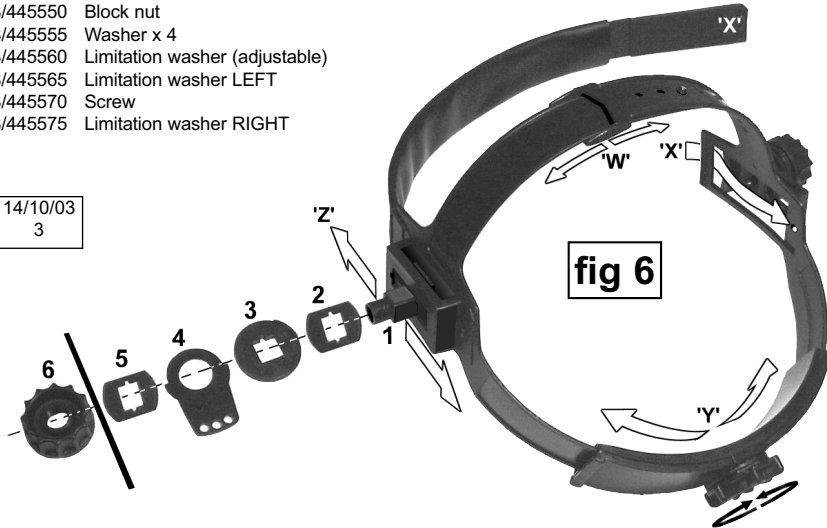

NOTE: It is our policy to continually improve products and as such we reserve the right to alter data, specifications and component parts without prior notice.
IMPORTANT: No liability is accepted for incorrect use of this equipment. **WARRANTY:** Guarantee is 12 months from purchase date, proof of which will be required for any claim. **INFORMATION:** Call us for a copy of our latest catalogue on 01284 757525 and leave your full name and address including your postcode.



Sole UK Distributor
Sealey Group,
Bury St. Edmunds, Suffolk.



01284 757500



01284 703534

Web address: www.sealey.co.uk

E-mail: sales@sealey.co.uk



AUTOMATIC WELDING HELMET

INSTRUCTIONS FOR MODEL NO: PWH599

Thank you for purchasing a Sealey Power Product. Manufactured to a high standard this product will, if used according to these instructions and properly maintained, give you years of trouble free performance.



IMPORTANT: PLEASE READ THESE INSTRUCTIONS CAREFULLY. NOTE THE SAFE OPERATIONAL REQUIREMENTS, WARNINGS AND CAUTIONS. USE THIS PRODUCT CORRECTLY AND WITH CARE FOR THE PURPOSE FOR WHICH IT IS INTENDED. FAILURE TO DO SO MAY CAUSE DAMAGE OR PERSONAL INJURY, AND WILL INVALIDATE THE WARRANTY. PLEASE KEEP INSTRUCTIONS SAFE FOR FUTURE USE.

1. SAFETY INSTRUCTIONS

❑ WARNING! THIS HELMET IS NOT SUITABLE FOR USE WITH LASER OR GAS-WELDING.

Ensure all workshop safety rules, regulations, and conditions are complied with when using welding equipment. The helmet will not offer protection against mis-use of workshop tools, equipment, or accessories.

Maintain the helmet in good condition, and protect cartridge from liquid and dirt contact. Regularly replace the protective lens and replace any damaged or worn parts. Use genuine parts only. Non authorised parts may be dangerous and will invalidate the warranty. NEVER open or tamper with the shade cartridge.

Select the shade level before use.

Ensure the front cover lens is securely in place before use.

Fit the helmet and adjust the head band so the helmet will sit as low and near to your face as possible,

Use helmet only in temperatures ranging from -5° C to 55°C (23°F to 131°F).

The eye protective plate in helmet is **NOT** unbreakable. Helmet will not protect you against severe impact hazards (**such as, but not limited to**) fragmenting abrasive discs/grinding wheels, stones and other grinding tools, explosive devices or corrosive fluids. The helmet will only protect the eyes and face from radiation and sparks.

Remove ill fitting clothing, remove ties, watches, rings, and other loose jewellery. Maintain correct balance and footing. Ensure the floor is not slippery and wear non slip shoes. Keep children and unauthorised persons away from the working area.

❑ WARNING! DO NOT use the helmet if damaged or you suspect it may be faulty. (Contact Service Agent).

DO NOT use helmet unless you have been instructed in its use by a qualified person.

DO NOT get the helmet wet or use in damp or wet locations.

DO NOT leave work place with helmet in lowered position, as bright light source may darken cartridge unexpectedly.

DO NOT place the helmet on a hot surface.

Clean helmet (see section 5.9) and store the helmet in a safe, dry, childproof location.

▲ DANGER! If, at any time, the face plate in the cartridge **FAILS** to darken when exposed to a welding spark, **DO NOT USE**. Remove cartridge and return to your dealer for checking. Continued use of the product knowing that the auto darkening feature is **NOT FUNCTIONING** may **DAMAGE YOUR EYES** and **CAUSE BLINDNESS**. Continued use of the helmet which is **not functioning** will invalidate the warranty and could prohibit a successful claim on any insurance company.

2. INTRODUCTION

High quality variable shade 9-13 lens manufactured and tested to BSEN379. Fully automatic, switches from light to dark on striking arc. Fitted with solar power panel, no batteries required. Features sensitivity switch and delay speed switch control for switching dark to light, preventing arc eye when welding at high power, whilst still providing fast switching for tack welding. Deluxe contoured helmet design approved to BSEN175 gives full neck protection and protects lens from scratching when helmet is laid down. Comfortable headband and non slip quick release ratchet mechanism. Suitable for MIG and arc welding. (Not suitable for use with laser or gas-welding).

3. SPECIFICATION

Viewing area 98 x 43mm (3.86" x 1.74").
Size of Cartridge 110x90x9mm (4.33"x3.54"x0.35")
Power supply Solar cells
Power On/Off Fully Automatic
UV/IR Protection Up to shade Din.16 at all times
Adjustable shade From 9 - 13
Clear state Shade DIN 3.
Response (light to dark) 1/20,000 sec

Response (dark to light) ● Position 'slow' = 0.6 - 0.8sec
● Position 'fast' = 0.25 - 0.35sec
Sensitivity Adjustable high/low
Helmet material Hi-impact Polyamide Nylon/Polyprop.
Total weight 435g
Operating temperature -5° C to 55°C (23°F to 131°F).
Storing temperature -20° C to 70°C (-4°F to 158°F).



4. INSTRUCTIONS FOR USE

WARNING! Before using the helmet for welding ensure you have read and understood the safety instructions in Section 1.

4.0 The helmet comes ready assembled but before it can be used it must be adjusted to fit the user properly and set up for response time, sensitivity and shade level.

4.1 **ADJUSTING THE FIT OF THE HELMET** The overall circumference of the headband can be made larger or smaller by rotating the knob on the back of the headband. (See adjustment 'Y' in fig.1) This can be done whilst wearing the helmet and allows just the right tension to be set to keep the helmet firmly on the head without it being too tight.

4.2 If the headband is riding too high or too low on your head adjust the strap which passes over the top of your head. To do this release the end of the band by pushing the locking pip out of the hole in the band. Slide the two portions of the band to a greater or lesser width as required and push the locking pip through the nearest hole (See adjustment 'W' in fig.1)

4.3 Test the fit of the headband by lifting up and closing down the helmet a few times whilst wearing it. If the headband moves whilst tilting re-adjust it until it is stable.



4.4 **ADJUSTING DISTANCE BETWEEN HELMET & FACE**

To adjust the distance between the helmet and your face in the down position loosen the tilt knobs on either side of the helmet and slide it nearer to or further from your face. (See adjustment 'Z' in fig.1) It is important that your eyes are each the same distance from the lens otherwise the darkening effect may appear uneven. Re-tighten the tilt knobs when adjustment is complete.

4.5 **ADJUSTING ANGLE OF THE MASK IN THE DOWN POSITION**

If the lens is not properly aligned with the eyes in the down position the mask angle can be further adjusted into one of three preset positions using the tilt plate shown in fig.2. Behind each pivot knob on the sides of the helmet there is a screw which passes through the side of the mask and into one of the holes in the tilt plate (see A,B,C in fig.2). Partially undo each screw anticlockwise so that it withdraws out of the tilt plate but remains in the side of the mask. Rotate the headband assembly so that one of the alternative positions is aligned with the end of the screw. Turn the screws clockwise again so that they pass through the holes thus fixing the position of the tilt plate.

4.6 **SELECTING SHADE LEVEL** Select the shade level you require according to the welding process you will use by referring to the "Shade Guide" below for settings. Turn the shade control knob on the side of the helmet to the shade number required.

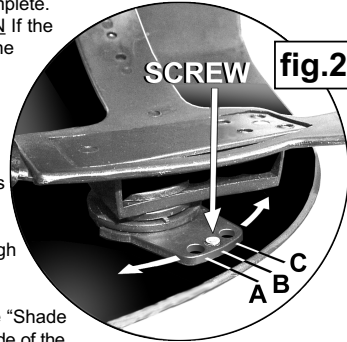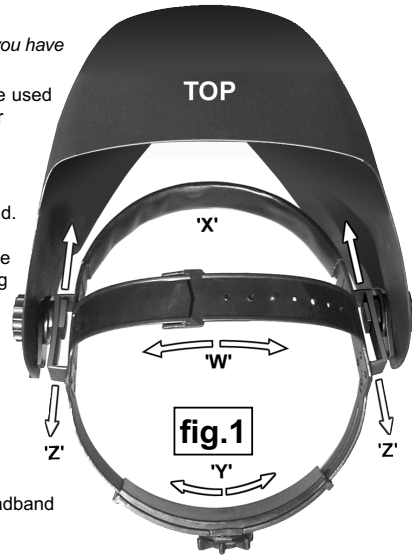


SHADE GUIDE	ARC CURRENT (AMPS)													
	0.5	2.5	10	20	40	80	125	175	225	275	350	450		
WELDING PROCESS	1	5	15	30	60	100	150	200	250	300	400	500		
SMAW shielded metal arc welding								9	10	11	12	13	14	
MIG on heavy metals										10	11	12	13	14
MIG on light alloys										10	11	12	13	14 15
TIG,GTAW gas tungsten arc welding								9	10	11	12	13	14	
MAG/CO ₂ metal active gas										10	11	12	13	14 15
SAW shielded semi-automatic arc welding										10	11	12	13	14 15
PAC plasma arc cutting											11	12	13	
PAW plasma arc welding	8	9	10	11	12	13							14	15

4.7 **SELECTING DELAY TIME** When welding ceases the viewing window automatically changes from dark back to light but with a pre-set delay to compensate for any bright afterglow on the workpiece. The delay time/response can be set to 'fast' (0.25secs to 0.35) or 'slow' (0.5secs to 0.8) as you require using the microswitch on the back of the shade cartridge. (See fig.3)

4.8 **SENSITIVITY** The sensitivity can be set to 'high' or 'low' using the microswitch on the back of the shade cartridge. The 'high' setting is the normal setting for everyday use. Where the operation of the mask is disturbed by excess light or another welding machine close by, use the 'low' setting. (See fig.3).

4.9 You are now ready to use the helmet. The shading may be adjusted during use by re-setting potentiometer control.

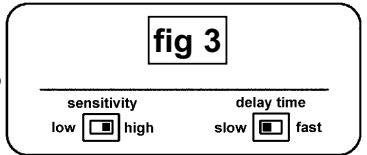

5. MAINTENANCE

5.1 **REPLACING FRONT COVER LENS.** Place your finger or thumb into the recess at the bottom edge of the window and flex the window upwards until it releases from one edge. (See fig.4-C). Remove the protective film from the new window and pass one edge under the side retaining lip shown at 'A' in fig.4. Flex the window upwards and tuck the other edge under the opposite retaining lip as shown at 'B' in fig.4.




5.2 **CHANGING THE SHADE CARTRIDGE.**

(See figs.5a & 5b) Pull off the shade control knob leaving the shaft protruding through the helmet side. Unfasten the nut on the shaft on its cable. The cartridge is retained by a wire loop clip as shown in fig.5b. Release the front edge of the clip (fig.5a-D) from its retaining lugs (fig.5a-E) and hinge it upwards and out of the way. Lift the shade cartridge out of its frame complete with the shade control potentiometer on its lead.

5.3 **FITTING NEW CARTRIDGE.** Take the new shade cartridge and pass the potentiometer cable under the wire loop before dropping the cartridge into its retaining frame inside the helmet. Hinge down the wire loop clip and ensure that the front edge of the loop is properly retained under the retaining lugs as shown in fig.5b

5.4 Fasten the nut on the shaft protruding through the hole. Push the shade control knob onto the shaft.

5.5 **CLEANING.** Clean helmet by wiping with a soft cloth. Clean cartridge surfaces regularly. Do not use strong cleaning solutions. Clean sensors and solar cells with methylated spirit and a clean cloth and wipe dry with a lint-free cloth.

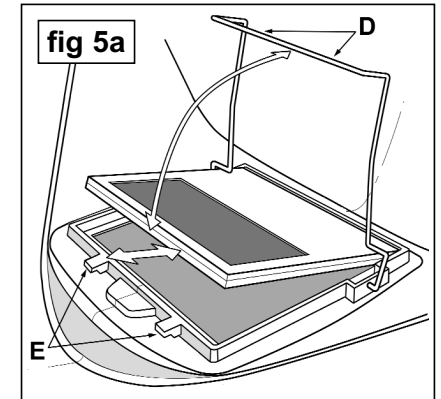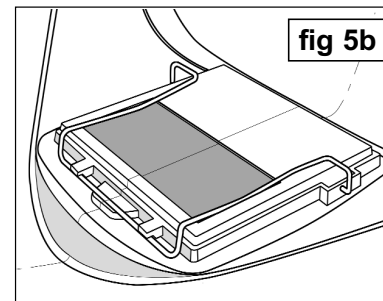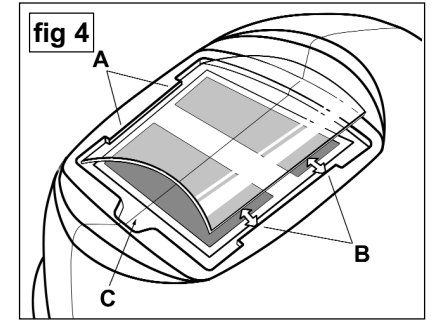

Declaration of Conformity We, the sole importer into the UK, declare that the product listed here is in conformity with the following EEC standards and directives. The construction file for this product is held by the Manufacturer and may be inspected on request by contacting Jack Sealey Ltd

**Automatic Welding Helmet
Model PWH599**
BS EN 175,1997 BS EN 169,2002
BS EN 379,1994

Signed by Mark Sweetman

20th June 2003

For Jack Sealey Ltd. Sole importer into the UK of Sealey Power Products